



Volvo

V70 up to vehicle ident. no.: 549452

S70 up to vehicle ident. no.: 571822

Moisture in the front indicators

In the case of these vehicles, it is possible that in wet and damp weather, water could penetrate the front indicators. In this case, the indicators do not have to be replaced. By making a ventilation opening an effective remedy can be achieved. To make the ventilation opening proceed as follows:

- Remove the indicators by pressing the retaining clips down.
- Remove the bulb socket.
- In the lower, rear area (see drawing), drill several holes to a length of 8 mm with a 3 mm drill, to produce a large elongated hole.
- **Caution: Drill through the indicator housing carefully, so that when puncturing the surface the indicator lens is not damaged.**
- Refit the indicators and carry out a functional test.

