Bulletin



© Hella KGaA Hueck & Co.,	20. Mai 2011	1-1
Lippstadt/Germany		

Volvo S70 | V70 | C70


Headlight vibration

With the above-mentioned vehicles, the headlights can vibrate on account of unevenness in the road surface or high speeds.

Types and production numbers that may be affected:

- S70 with factory code 1 (11th position in the VIN) from production no. 409466 (12th to 17th position in the VIN)
- S70 with factory code 2 (11th position in the VIN) from production no. 408556 (12th to 17th position in the VIN)
- S70 with factory code 3 (11th position in the VIN) from production no. 422325 (12th to 17th position in the VIN)
- V70 with factory code 2 (11th position in the VIN) from production no. 342001 (12th to 17th position in the VIN)
- V70 with factory code 3 (11th position in the VIN) from production no. 356958 (12th to 17th position in the VIN)
- C70 with factory code J (11th position in the VIN) from production no. 000339 (12th to 17th position in the VIN)

To remedy the situation, an additional bracket (drawing, pos. A) is mounted per headlight; these brackets are available through the dealerships.

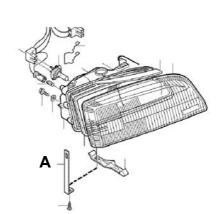

Bulletin

