



Volvo S 80 ***All petrol models with electronic*** ***accelerator-pedal sensor***

Engine speeds in excess of 4000 rpm not possible.

If there are complaints with these vehicles that it is not possible to increase the engine speed above 4000 rpm, irrespective of the gear selected, one possible cause is a defective or heavily-contaminated throttle-blade housing. In order to eliminate the fault, try cleaning the throttle-blade housing. If this does not have the desired effect, the throttle-blade housing must be replaced.

Note:

After replacement, the new throttle-blade housing must be adapted to the engine control unit using suitable diagnosis equipment.

Bulletin

