Bulletin



© Hella KGaA Hueck & Co., Lippstadt 30th March 2006 1-1

Volvo V70 Model year 1997 – 2000 With 2.4 I engine (B5244S2)

No brake booster support, poor engine running.

If there are complaints with these vehicles that there is no brake booster support and the engine is running poorly, one possible cause is a faulty vacuum hose. The problem affects the vacuum hose to the brake booster. There is a connection point in the vacuum hose below the air filter where the hose can become loose. To eliminate the problem, the vacuum hose must be inserted onto the connection piece again and be secured against slipping by a hose clamp.

To reach the connection piece, the air filter box has to be removed.

Then the fault memory should be read out and any fault entries connected with the above problem deleted.



