



## **Volvo**

***V70 | XC70 | S60 from model year 2001***

***XC90 from model year 2003***

***S80 from model year 1999***

### **Whistling noises**

With the above-mentioned vehicles, whistling noises can occur in the area of the dashboard, particularly at speeds from 80 km/h onwards.

The reason for this is often an incorrectly positioned seal between the components of the ventilation/blower unit and the body. To remedy the situation, the seal between the body and the evaporator box should be checked and re-aligned first. Pay particular attention to gap dimensions and overlap.

To reach the respective area, the cover must be taken off the coolant tank and the coolant tank itself must be dismantled.

Annoying noises can also occur in recirculating operation due to a flap not closing exactly, for example.

In such cases, housing gaps should be sealed by attaching felt adhesive strips.

**Bulletin**