



VW

Noises out of the steering column.

If dragging or clicking noises are heard from the steering column, a possible cause could be a too small or too large a gap between the return ring assembly (picture 3) and the steering wheel. If the gap is too small, the return ring is dragging along the steering wheel. If the gap is too big, the clips are loose and not locked into the steering column.

To eliminate the noise, the gap must be readjusted. To do this consider the following steps:


- Remove the upper steering column trim (picture 1).
- Loosen the retaining screw of the steering column lever (picture 2).
- Adjust the gap between return ring assembly and steering wheel to approximately 5 mm (picture 2).
- Tighten the retaining screw and refit the trim.
- Check the function.



Picture 1



Picture 2

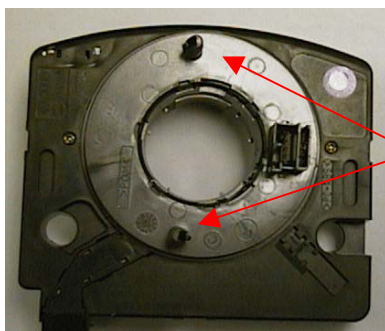

Clips

Picture 3