



## ***VW Bora, all models until August 2000***

### **ABS warning light comes on**

If there are complaints about the above-mentioned fault, contact difficulties with the rear wheel speed sensors could be the cause. Faulty brackets for the ABS plug connections can make these become loose due to vibration and lead to the above-mentioned fault. In this case the brackets on both sides should be checked. If they are too loose they can simply be pressed together again slightly (approx. 2 - 3 mm) in order to increase the pressure on the plug connections. In addition, cable ties can be used to fix the cables in place near the plug connection. Following these measures, delete the fault memory and check the ABS system to make sure it is working perfectly.

**Bulletin**