

8. Februar 2006

VW Caddy Model year from 1999 to 2002

Airbag warning light comes on

If there are complaints about the above-mentioned fault, a frayed cable strand can be the cause. In this case the fault "ignition airbag/belt tensioner short-circuit to ground" is stored in the fault store. Proceed as follows to localise the fault.

- Use a diagnosis tester to read out the measured value block. This serves to check whether the fault is currently occurring.
- If the fault is not occurring, an attempt should be made to simulate the fault. To do this, wobble the front seats, put a load on or adjust the backrests and move the seats backwards and fowards as far as they will go.
- If the fault cannot be simulated, the cable strands on the airbag units must be checked for damage. Pay particular attention to any chafed spots. These can occur near the seat adjustment.
- If a chafed spot is found it must be repaired using insulating tape. Re-lay the cable strand if necessary and fix in place.
- Then delete the fault memory.





1-1