



## **VW**

### **Golf 4 (1J)**

### **Engine: 1.4 ltr. 16 V**

### **With air-conditioning**

### **Radiator fan / air-conditioning unit do not work; fuse contact burnt**

Should in the vehicles specified above the air-conditioning unit or the cooler/condenser fan have a malfunction, then the cause might be a burnt fuse contact at the fuse holder in the engine compartment (Fig. 1). The fuse itself is okay and the burnt plug contact (Fig. 2) cannot be detected visually.

The fault can be remedied by replacing the fuse holder and the fuse. The cause is not clear. Probably, this is to do with the lessening pressing force of the plug contacts.

There is a possibility that the fault may occur in other vehicles/engine variants as well.



Fig. 1

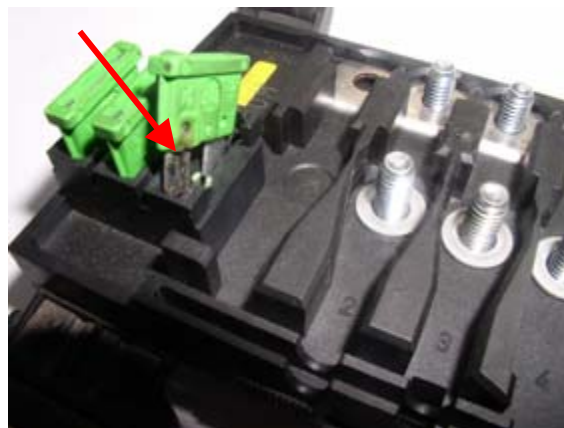


Fig. 2

Blitz-Info