



## **VW Golf IV, Bora** **All models with electrical window lift**

### **Window does not close completely despite switch being actuated.**

If there are complaints with these vehicles that the windows do not close completely despite the switch having been actuated, one possible cause is an interruption in voltage caused by the battery being disconnected or replaced, the window lift motor or respective fuse.

The window lift has to be re-initialized to eliminate the fault.

To do this, proceed as follows **with the window closed**:

- Switch on the ignition
- Keep the window lift in the "close" position for at least 2 seconds.
- Release the switch.
- Keep the switch pressed in the "close" position again for another 2 seconds.

This completes initializing for the upper switch-off point. Open the window to the lower switch-off point and repeat the process described above in the "open" switch positions.

Proceed as follows with **the window opened**:

- Actuate the window lift switch until the window switches off at the upper switch-off point.
- Release the switch
- Actuate the "close" switch for at least 2 seconds.
- Initialization of the "close" process is completed.  
Further procedure as described above.

Repeat the process in the same way at all the other window lifts and the electric sunroof if appropriate.