



VW Golf IV, Bora All models with Xenon headlights fitted as standard

Headlights shine too low.

If there are complaints with these vehicles that the headlights shine too low and the headlight levelling feature is not working, one possible cause is a software fault in the headlight levelling control unit. To eliminate the fault, a suitable diagnosis unit must be used to check the control unit software status. If a control unit with the software status V03 is installed, this has to be replaced by a control unit with software status V05 or V06.

After the control unit has been replaced, the regulation (basic setting) of the headlights must be re-learnt. Note that here, the control unit has to be put into setting mode by the diagnosis unit for the basic setting to be carried out. This basic setting is stored by the control unit.

Bulletin

