




VW Lupo **All vehicles with manual air** **conditioning up to model year 02.2000**

Air conditioning occasionally does not work

If there are complaints about the above-mentioned fault, the cause could be a defective pressure switch. Under certain operating conditions of the air conditioning system, the defective pressure switch switches the system off occasionally. In this case, the pressure switch, in the high-pressure circuit, must be replaced. The pressure switch can be removed without having to recover the refrigerant.

Proceed as follows:

- Remove the bumper trim. The pressure switch, on the filter-dryer, is located on the right, behind the trim.
- Remove the plug connection (1).
- Hold the refrigerant line (3) steady when unscrewing the pressure switch (2).
- Replace the sealing ring, and screw the new pressure switch (Behr-Hella no.: 6ZL 351 028-221) on tight to a torque of 8 Nm.
- Refit removed parts in reverse order.

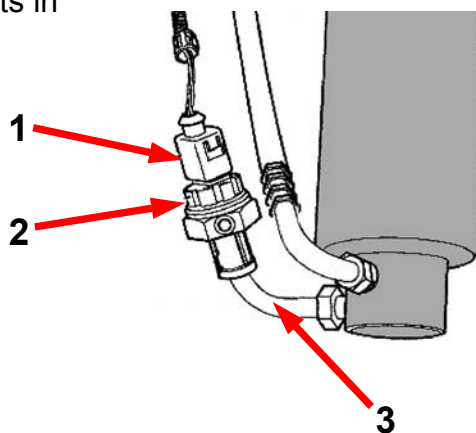

Bulletin