



## **VW**

### **Lupo**

### **Engine: 1.2 TDI (ANY, AYZ)**

#### **Engine judders / cuts out**

If, in the case of the above-mentioned vehicles, the engine cuts out or/and judders, this may be related to a blockage of the vacuum connection on the air intake pipe (photo). In this event, the fault code 17965 or P1557 (boost-pressure control) is often stored in the fault memory. In case of complaint, the connection must be checked for passage with the aid of a vacuum pump. If the connection is blocked, the entire intake air ducting should be replaced. Please do not forget to check the line from the connection pipe to the boost-pressure control valve.

