



VW

Passat (3C)

Model year: 11.2005 + 12.2005

Engine: 2.0 FSI (110KW)

Engine jolty /

Poor engine power

With the above-mentioned vehicles, sporadic switch-off of the fuel pump can lead to jolting of the engine or reduced engine power. One possible cause for this is a software fault, which leads to excess voltage and switches off the fuel pump part of the time under full throttle.

The vehicle manufacturer has informed all vehicle owners concerned and asked them to visit an authorised garage for the vehicles to be checked over. It must be assumed however, that there are still vehicles on the road that were not checked or modified for various reasons.

Vehicles which have had a software update installed are marked by a sticker with "24K1" on it applied near the spare wheel well.

Bulletin

