



## ***VW Passat 1.8 T (B5)*** ***Engine code ANB*** ***Model year from 1999 to 2000***

### **Poor engine running**

If there are complaints about the above-mentioned problem, one or more faulty ignition coils could be the cause. The customer could possibly complain about further points such as poor start-up behaviour or idling and poor throttle response during acceleration. In this case the ignition coil(s) has/have to be replaced. Insufficient insulation of the ignition coil wiring harness can also lead to such faults.

We therefore recommend installing modified wiring harnesses. When dismantling the ignition coil(s) note that these have to be pulled vertically upwards to be removed. If the ignition coil should be stuck, never turn it try to lever it off (this will destroy the spark plug).

Spare part: ignition coil (Hella no.: 5DA 006 623-771)

**Bulletin**

