



## **VW**

### **Polo (9N2)**

### **Model year: 2001**

### **With air conditioning system**

#### **Jammed button for AC / recirculated air**

In the case of the above-mentioned vehicles, it may be that the AC or recirculated-air button sometimes jams when pressed. Since the buttons come into contact with the cover, they no longer work. Check if the recirculated-air/AC buttons also jam with the cover removed. If this is not the case, the elements of the heating and fresh-air regulation, as well as the cover, should be realigned. If this action does not solve the problem, the cover must be reworked mechanically in such a way that there is no contact between the buttons and the cover. Vehicles from model year 01.2002 (from vehicle identification no.: 9N2 Y 069800 or 9N2 D 053465) were supplied from the factory with a modified cover already fitted.

Bulletin