



VW Sharan **Model year 2001 - 04/2002** **with TDI engine & air conditioning**

Failure of the air conditioning.

If there are complaints with these vehicles that the air conditioning system is not working, one possible cause is a lack of refrigerant. A leak in the pipe between the compressor and the condenser leads to a loss of refrigerant and failure of the air conditioning system. Due to deviations from the reference value during production, the pipe was installed under stress and becomes leaky over time due to vibrations. During troubleshooting, the pipe connection between compressor and condenser should be checked for leaks. If the pipe is leaky, it must be replaced by a new modified version.

In the case of vehicles from model year 04/2002 and chassis number: 7M 2V 050 000 onwards the modified refrigerant pipes have been installed in series production.

Bulletin