



VW Sharan From model year 2001 with 1.8l turbo engine

Various fault codes stored in the control unit, engine control lamp illuminates.

If there are complaints with these vehicles that the engine control lamp illuminates and the following sporadic fault codes are stored in the engine control unit: 16645, 16648, 16651, 16654, 17833, 17525 and 17843, the reason could be the fuel pump relay. To eliminate the problem, a modified fuel pump relay must be installed. The part number on the relay reveals whether it is an old or new version.

Old part number: 6NO 906 383 **A**

New part number: 6NO 906 383 **B**

The relay is at slot 21 in the lower relay carrier, behind the fuse box.

Bulletin