

© Behr Hella Service GmbH, Schwäbisch
Hall/Germany

30. April 2010

Volkswagen Transporter T5 Engine code BLJ, AXE Compressor

Air conditioning is not cooling the vehicle


With this vehicle, the compressor is not driven by a V-ribbed belt, rather by means of a flexible coupling sleeve with internal gearing.

A fault on the free-wheel clutch mounted on the compressor leads to damage to the internal gearing of the rubber muff and compressor drive is no longer guaranteed.

The free-wheel clutch is not part of the compressor and can be replaced separately.



In addition, please check the dimensional accuracy of the compressor bracket and the existence of the required centring sleeves. If there are deviations with the bracket, replace it.

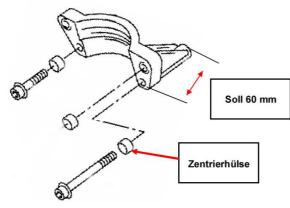

Bulletin





1-1