

Window regulator initialisation failure

Part Number: 850902 and 850903


For Vehicle: Mini R56 2006-2013

The Valeo Service Technical department have had several calls stating that on the Mini R56 2006> after fitting window regulators 850902 or 850903 there is a power malfunction or the window does not close fully.


After investigating the issue Valeo technicians have identified that the window regulator is not the problem. The issue is caused by an incorrectly adjusted power window mechanism.

To fix the issue please complete the following steps:

1. Close the window and partially close the door A, Check the position is correct as shown in B and C.

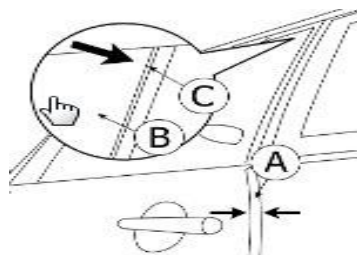

2. Remove the covers A, Loosen the bolts B, Adjust the power window mechanism C, Tighten the bolts B and refit the covers A.

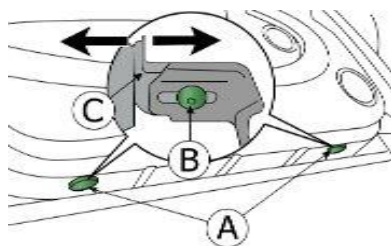

3. Loosen the window glass retaining bolts. Adjust the glass upwards and towards the door front, tighten the bolts. After adjustment initialise the power windows then press and hold the power window open switch. Open the window fully press and hold the power window close switch then hold for 3 seconds.