valeo added IIIIIII

Technical.bulletin

IGN-006 **2016**

251494 - Failures due to vehicle faults

Part Number: 251494

For Vehicle: Citroen Berlingo Mk2

Valeo Technical Support has received a number of calls on Valeo column switch 251494 with several issues being reported. After further investigations no actual faults was found with the unit. Detailed below are the reported issues.

The headlights and auto wiper function are not working

This can occur after the battery has become discharged (battery voltage very low) or been removed. To remedy this please follow the below steps:

- 1. Turn the ignition key to position 1
- 2. Press the button on headlight switch and hold for 3 seconds until an audible beep is heard.

This will then enable the auto wiper to function correctly. There is no need to replace the column switch.

The airbag warning light is randomly illuminating

If the above occurs please check the airbag wiring is not chafing against the front seat brackets. This will cause the wiring loom to wear disrupting the contact. If necessary replace the wiring loom or reroute the wiring accordingly.



