

Faulty master cylinder

Part Number: 826374 and 810029

For Vehicle: Renault Trafic 1.9 DCI 2001> (Up to engine number C034957)

The Valeo Service Technical department have received several claims stating that after fitment of clutch kit 826374 and CSC 810029 there is an issue where the clutch pedal sits low or drops to the floor.

After further investigation Valeo technicians have identified that the clutch kit itself is not at fault and the symptoms seen are as a consequence of the return spring in the master cylinder being broken or collapsing. The seals on the master cylinder also have a tendency to leak, causing the pedal to not return to the normal position.

To fix the issue Valeo Service advise to check the following:

- 1) While replacing the clutch, check the master cylinder for leaks. Also check for damage to the return spring.
- 2) If there is any sign of them being worn or damaged, replace the master cylinder (OE number 8200031239).



Please note there is no need to change the clutch kit