

Squealing noise from the clutch area

Part Number: 826728

For Vehicle: Kia Picanto 2004>

The Valeo Service Technical department have received several claims stating that after fitment of clutch kit 826728, there is a squealing noise emitting from the clutch area.

After further investigation Valeo technicians have identified that the clutch kit itself is not at fault, the actual cause is as a consequence of insufficient clearance.

To fix the issue Valeo Service advise to check the following:

- 1) Adjust the clutch cable and check the clearance, it should be between 3 - 4 mm of free play.
- 2) Press the clutch pedal several times to settle the cable.
- 3) Check the clutch pedal free play. Expected value: 15 - 20 mm and adjust if necessary.

Please note there is no need to replace the clutch kit