Technical.bulletin

Mini R55/R56 - difficulty with gear changes

Part Number: 826724

For Vehicle: Mini R56 2006-2013, R57 2009>, R55 2007-2012


The Valeo Service Technical department have had several claims stating that after fitment of clutch kit 826724 there is difficulty with changing gears.

After investigating the issue Valeo technicians have identified that the clutch kit itself is not at fault and the cause is related to either a faulty gear-shift cable assembly or a faulty selector lever circlip.

To fix the issue please ensure the following steps are completed:

1) Check the gear-shift mechanism for any faults and check the operation of the gear-shift lever.

2) If necessary, renew circlip A and renew the sleeve stop on the gear-shift control cable (B).

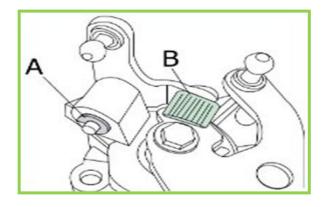

Repair time

Renew the circlip (Time: 0.80) (OE Code: 25 11 000) Renew the gear-shift cable assembly (Time: 1.50) (OE Code: 25 11 007)



