

Reverse light not functioning due to control unit failure

Part Number: 044075 and 044076


For Vehicle: Seat Leon 2005-2012

The Valeo Service Technical department have received several claims stating that after fitment of rear lamps 044075 (nearside) or 044076 (offside) the reversing lights fail to illuminate.

After investigating the issue Valeo technicians have identified that the lights are not at fault and the symptom described above is caused by a faulty on-board network control unit (J519).

To rectify the issue please complete the following steps:

- 1) Select reverse gear and using a multimeter check the output voltage.
- 2) If there is no voltage you need to replace the faulty on-board network control unit J519. To do this remove the driver side foot well cover. As illustrated in the diagram below, lift tab 2 and remove the on board control unit (BSG) from its support. Unplug connector 1.

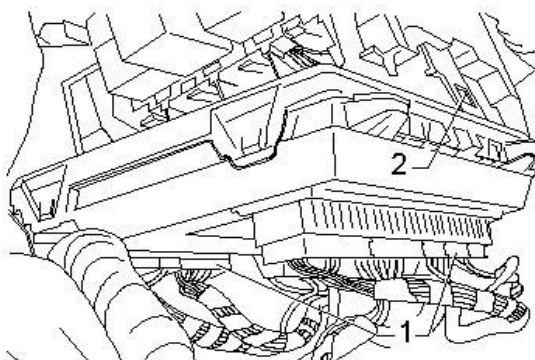

- 3) Reprogram the faulty on-board network control unit (J519) to ensure compatibility with the new lights.