

## VW Golf - faulty clutch hydraulic pipe

Part Number: 826339

For Vehicle: VW Golf 1.4 10.03-11.08

The Valeo Service Technical department have received several claims stating that after fitment of clutch kit 826339 there is difficulty with changing gears. Also it has been noted that the clutch pedal does not return to the rest position after changing gears.

After investigating the issue Valeo technicians have identified that the clutch kit itself is not at fault. The fault is caused by a faulty or worn clutch hydraulic pipe.

Before attempting to replace the clutch kit checks should be made to the pedal box assembly to ensure it is operating correctly. If no fault is found check for correct operation of the master cylinder paying special attention for any leaks that may be present in the hydraulic pipe.

If any leaks are detected replace the hydraulic pipe.

