


To Fit:

Various Renault models fitted with a JB or JC manual transmission



EN

Gear Selector Lever Repair Kit

Problem

Transmission oil leaking past the gear selector lever oil seal. The gear lever is firmly attached to the gearshift lever. Therefore, it is difficult to replace the shaft oil seal. The gearbox should be removed from the vehicle and partially dismantled so the repair can be carried out. This is time-consuming and therefore an expensive repair for the vehicle owner.

Cause

Over time, the seal wears on the moving selector shaft and hardens with age.

Solution

Before carrying out this repair, care should be taken to clean all parts thoroughly.

The repair kit 47222 offers the option of sealing the shaft using two half shells and two O-rings. This significantly reduces the time required for this repair as the gearbox does not need to be removed in order to carry out this repair.

The repair kit comprises of:

- Two rubber O-rings
- A wire which is used to pull the rubber O-rings over the gear lever and onto the shaft
- Two half shells
- A plastic plate which is used to drive the two half shells together with the inserted rubber O-rings into the opening
- A metal plate

For more technical information please visit: partsfinder.bilsteingroup.com