

© Hella KGaA Hueck & Co., Lippstadt


Daewoo

29. Januar 2004

Lanos up to model year 2001

Faults in the engine electronics

In the case of the above-mentioned model, various faults can occur in the engine electronics. Before apparently faulty components are replaced, these must be examined thoroughly. Particular attention must be paid to the engine wiring harness (illustration, pos. B) near the right-hand A-pillar (illustration, pos. A). There may be breaks in the wiring in the area marked on the illustration.

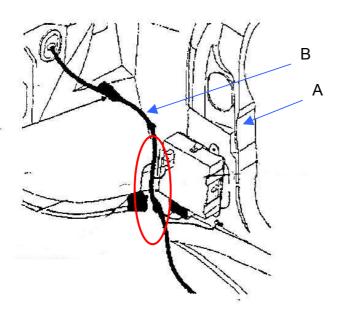

Bulletin





1-1