




Renault Espace 2 (JIS63) with 2.0 ltr. petrol engine

Leaking refrigerant hoses

The refrigerant hoses on the above mentioned vehicles are exposed to the radiant heat of the engine due to their position. Over an extended period of time, this can cause the hoses to dry out and leak (see picture). The suction hose is particularly affected. In extreme cases the hose can burst.

For longer durability, the new hoses should be fixed as far away from the exhaust manifold as possible.

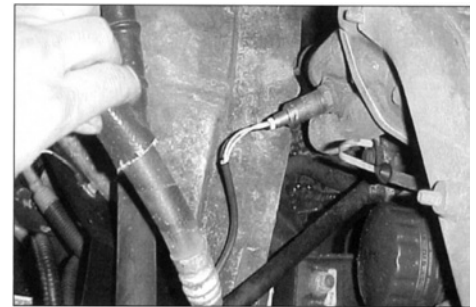

Bulletin