




Fiat Punto (188) all models with air conditioning

Ingress of condensation water into the passenger compartment.

If, on this vehicle, the complaint is that condensation water ingress into the passenger compartment, a possible cause could be a blocked condense water drain.

To rectify the problem, the condense water drain on the fire wall must be renewed. The new condense water drain has the same part number as the original. The difference between the old and new one is the form (see drawings below).

Please compare the new with the old condense water drain before fitting to be sure that the problem does not recur.

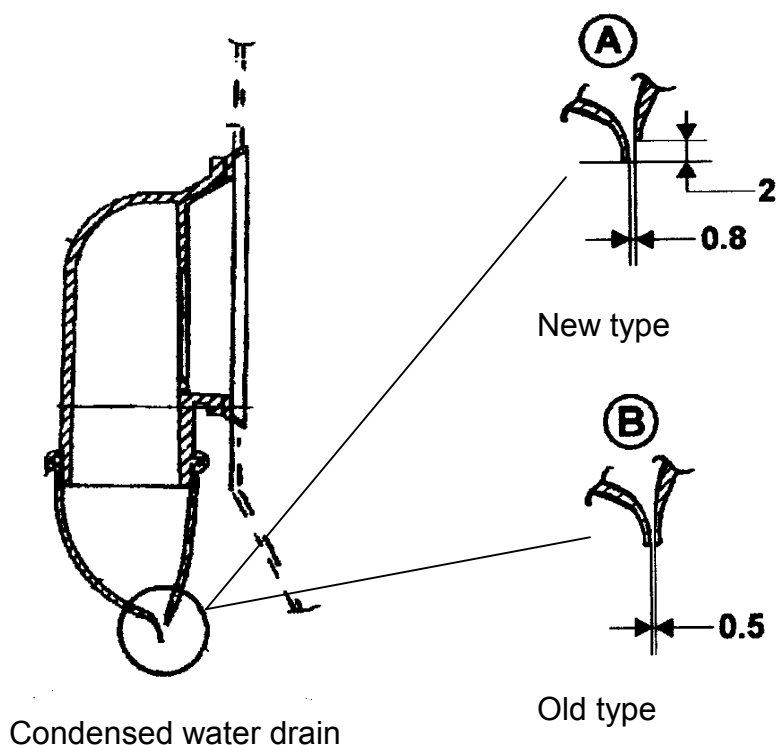

Bulletin