




Mercedes Benz C-Class (W 202) all models

Noise from the fan in the passenger compartment

If there are complaints about noise from the blower in the passenger compartment with this vehicle type, this can have been caused by the following: soiling of the air intake ducting in the engine compartment and the fan by debris fallen.

To eliminate the noise, proceed as follows:

- Dismantle the cover of the air intake on the right and left as well as the pollen filter.
- Remove debris and other soiling.
- Remove the fan in the passenger compartment in the footwell on the front passenger side.
- Clean the fan and the air ducting.
- Replace the components in the reverse order.

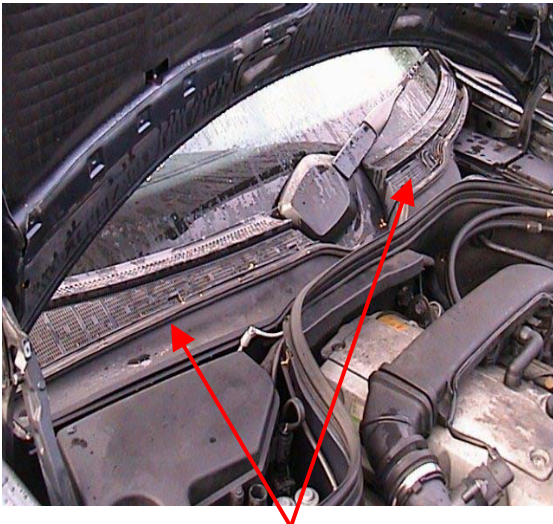

Covers / Pollen filter



Passenger compartment blower