




Opel Corsa B manufact. year 93-95
Opel Tigra manufact. year 95
All versions with A/C

Noises from the footwell

If the above mentioned fault is queried, the cause could be the flap (1) of the condensed water drain. These rattling noises occur, if the A/C blower is in position 2 or 3. In this case the flap must be removed from the condensed water tube. This operation can be carried out in the engine compartment.

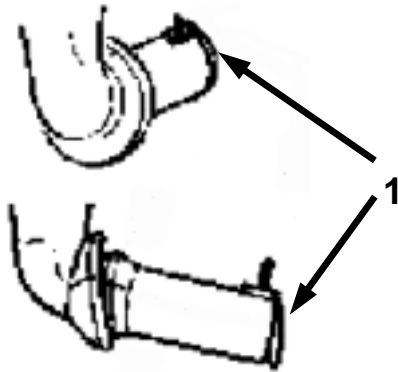

Bulletin