Bulletin




© Behr Hella Service GmbH, Schwäbisch Hall	01. Oktober 2005	1-1
--	------------------	-----

Saab 9-3 all models with manual air conditioning

Stiff heating regulation.

If there are complaints with these vehicles that the heating regulation is stiff, one possible cause could be a damaged actuation cable on the heating flap. A stiff heating flap can cause the actuation cable to become kinked or tear. To eliminate the fault the actuation cable has to be replaced and the heating flap checked for perfect function.

When the new actuation cable has been mounted, turn the temperature regulator to cold/hot to check whether the respective final position of the heating flap is reached.

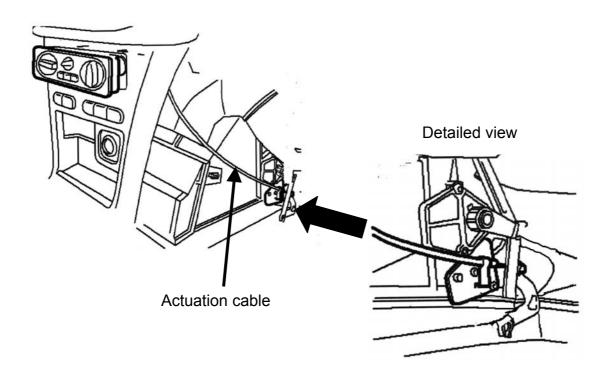

Bulletin

