

© Hella KGaA Hueck & Co.,	8. January 2009	1-1	
Lippstadt/Germany			


VW Golf 3 (1H)

Instrument cluster / Switch rear window heating: implausible functions

With the above-mentioned vehicles, an implausible function of the lighting and the control lamp on the switch for the rear window heating can occur.

The lighting on the instrument cluster switches on, for example, when the rear window heating is actuated. On the other hand, the control lamp for the rear window heating switch lights up when the lighting is switched on.

This can be caused by a cable break in the cable feed through the tailgate (photo). If removal of the cable feed shows that the cable is broken or the insulation damaged, professional repairs can restore the correct lighting function again.

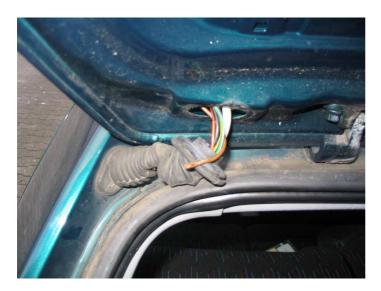

Bulletin

