

Vauxhall Corsa (Mk3) low beam malfunction

Part number: 44587, 44588, 44591, 44592


For vehicle: Vauxhall Corsa, MK 3, 2011 model

The Valeo Service Technical department have had several calls stating that after the warranty period of the vehicle has expired, the headlight has begun to fail intermittently or a complete malfunction of the low beam has occurred.

After further investigation, Valeo technicians have identified the cause to be faulty wiring leading to the headlight connector.

In order to diagnose and resolve the issue, Valeo recommend the following steps:

- Check the headlight power supply for correct function.
- Check the headlight alignment and adjust if necessary.
- Check the headlight levelling sensor for correct function.
- Check and repair, if necessary, the wiring from the low beam to the headlight control unit. Further diagnosis may have to be performed to diagnose the cause of the damage to the wiring.

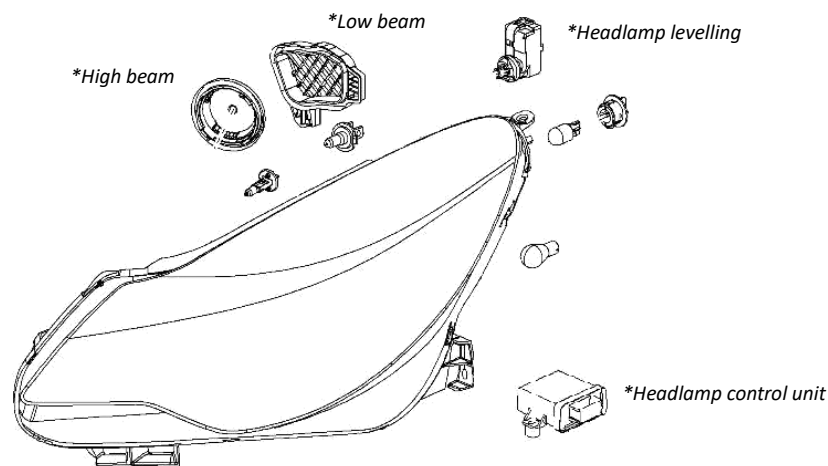

**See vehicle manufacture recommendations for correct values and function.*

Valeo also recommend replacing the bulb if any of the above has caused the fault, as the malfunction may have caused irreparable damage to the low beam bulb.