


## Replacement of the wiring loom

Part Number: 698364, 698330, 698281

For vehicle: Renault Applications

The Valeo Service Technical department have received several calls stating that an additional loom has been supplied with the blower motor but customers are unsure if it is required. Blower motors 698364, 698330 and 698281 have been modified and the original connector must be removed and replaced by the connector provided within the box.


*Old connector*

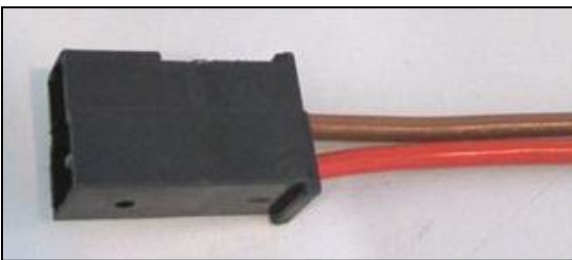

*New connector*



Remove the old connector by cutting it, make sure beforehand that there is no deterioration on the cable. Strip the cables exposing several centimetres of copper wiring.

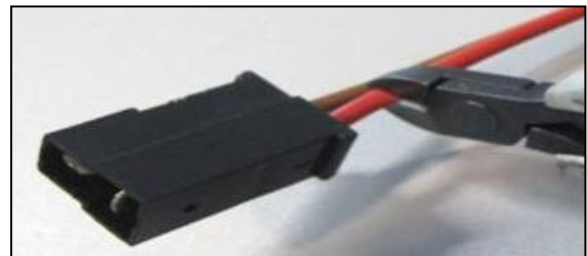

Crimp the new connector cables on the existing cables. Add a trunking to protect the cables. It should be remembered that a bad connection, can generate a significant increase of temperature with a risk of fire starting.

