

Technical Bulletin

Technical Helpline: +44(0)1622 833004 Fax: +44(0)1622 834004

Nissan Micra K10 Series Clutch

Date Issued:01/07/02

We have found that the Nissan Micra suffers from common problems causing premature clutch failure. Awareness of these problems prior to fitment will allow the correct preventative action to be taken.

Symptoms:


Jerky/stiff pedal operation

Clutch drag (poor gear selection)


Release bearing wear (causing bearing noise)

Clutch slip

Probable Causes

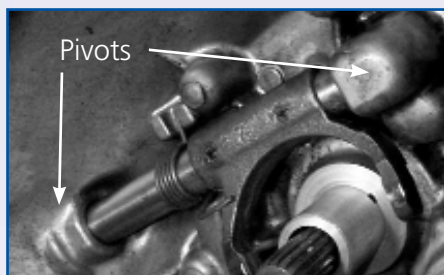

Worn or Seized Release mechanism pivots

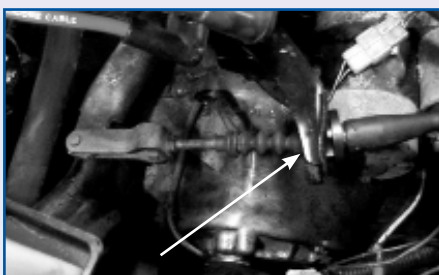

Clutch cable seizure



Transmission guide tube wear


Symptoms:

Clutch Drag

Clutch Slip

Severe clutch disc hub wear


Probable Causes

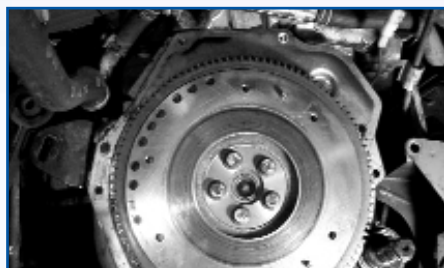

Flywheel wear



Gearbox location dowels
(missing or damaged)

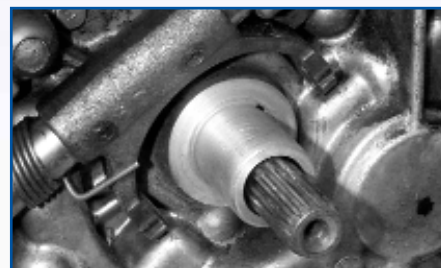

Mainshaft bearing wear (Movement)

Disclaimer : Any technical tips are produced in good faith. Blue Print, always recommend that vehicle maintenance and diagnostics are only carried out by suitably experienced people using appropriate tools in a safe manner within a workshop environment. Blue Print, and their customers cannot be held responsible for the correctness of, or misinterpretation of the above technical tips. Images shown are for illustrative purposes only and may not be representative of the products or vehicles described.



www.blue-print.com