



Ford Focus, build till 08/2000


Blower or blower switch without or sometimes without function.

If, on this vehicle the problem is that the blower, blower switch does not function or a smell of melting plastic is present, a possible cause could be a bad electrical contact on the connector of the blower switch. To rectify the problem a new blower switch and connector must be installed. For this consider the following steps:

- Remove the radio (radio code is available ?).
- Remove the baffle of the climate control (4 screws, picture 1).
- Remove the blower switch and fit a new one (picture 2).
- Cut the wiring of the blower switch 40 mm after the faulty connector.
- Refit the new connector using
- Refit the parts in reverse order, code and reprogram the radio.



Picture 1, 4 screws

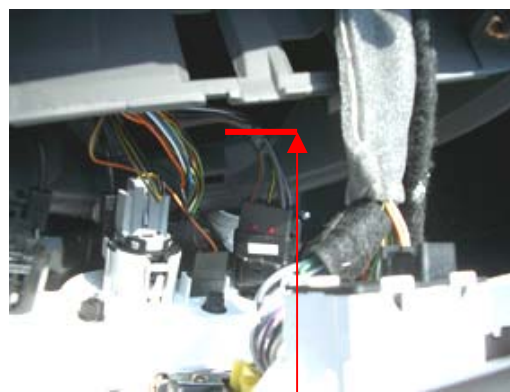

Picture 2, cut