



Ford Mondeo Model year 2001


Noises from the heating system.

If there are complaints with these vehicles that knocking, clapping noises can be heard from the heating system when the fan is switched to stage 3 or 4, one possible reason is the temperature flap in the heating housing swinging up and down. The high air speed in fan stages 3 and 4 causes the flap to bang against the housing. The problem can be eliminated by installing a rubber stop on the setting motor of the temperature flap. To do this proceed as follows:


- Remove the glove compartment
- Remove the setting motor of the temperature flap, loosen 3 Torx screws and separate the plug-type connections.
- Push the rubber stop onto the setting motor shaft (metal disc facing the temperature flap).
- Replace the components in reverse order.

Note:

From 06.2001 a modified temperature flap was used which prevents swinging. The necessary spare parts (rubber stop) must be purchased from Ford.

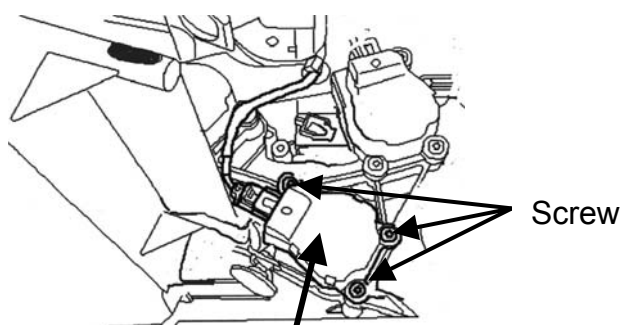

Temperature flap setting motor

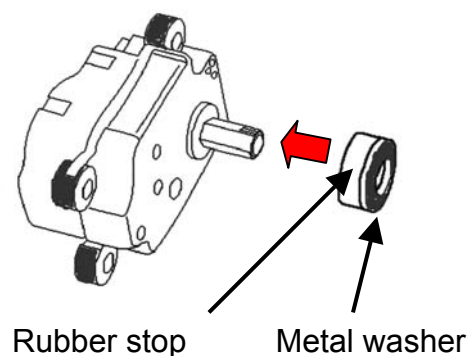

Rubber stop

Metal washer

Bulletin