



# BULLETIN

## Opel Corsa-D

### Model year 2007


### Engine: Z10XEP, Z12XEP, Z14XEP, Z13DTJ

#### Front brake system

#### Squeaking noises when braking

If the symptom specified above cannot be allocated to any detectable defect on the wheel brake, one possible cause of this is an insufficient decoupling between the brake pad and the brake caliper. For improving comfort, the vehicle manufacturers have installed so-called "Piston Caps" in the piston (A) of the brake calipers.

In case of a complaint, this must be checked and renewed where appropriate. On vehicles affected without "Piston Caps", these can be retrofitted.

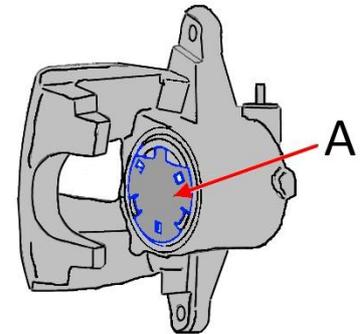


#### Note

These additional "Piston Caps" (B) have been introduced to the production from the following chassis numbers.

Eisenach: W0L0SDL0876108784

Zaragossa: W0L0SDL6874284654

Spare part number "Piston Cap": Vauxhall 93169307

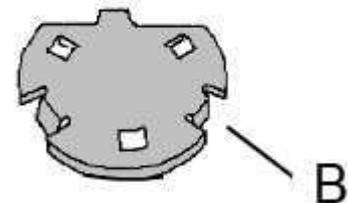

Please observe the maintenance and repair notes provided by the vehicle manufacturer in this context!