




## **Renault Laguna (B56, K56)** **With semi or fully automatic temperature control**

### **Functional failure /** **"Service" and "Temp" light up**

If the air conditioning function should fail with the above-mentioned vehicles and/or the "Service" and "Temp" lamps light up on the air conditioning control unit when starting the vehicle, a false connection of the alarm system LED can be the cause. The fault "micro-motor", "air recirculating" and/or "air distribution" can be stored. Before replacing any components the correct connection of the LED "alarm system" should always be checked. The LED must not be connected between +AVC (30) and +APC (15). Otherwise the LED must be disconnected and reconnected as follows with the aid of a Hella changeover relay (e.g. Hella part no.: 4RD007794-041) (pin 87 is not occupied):

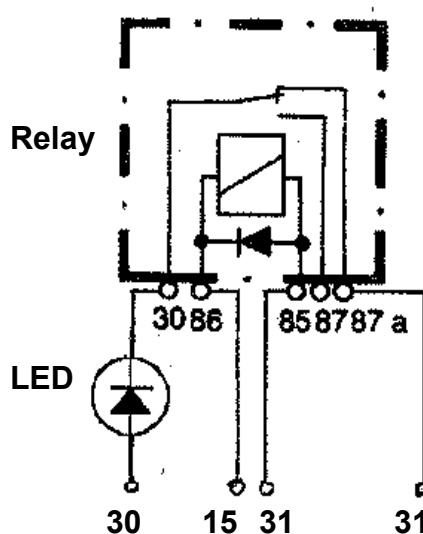

Bulletin