




Saab 9.3 (YS3D) **Model year: 1998 - 2003** **With 2.0 litre engine**

Compressor does not switch on or off sometimes

If with the above-mentioned vehicles the compressor does not switch on or off immediately following activation of the air conditioning system, the reason could be a faulty compressor thermal switch.

Before replacing the complete compressor the thermal switch should be checked and/or replaced. To replace the switch proceed as follows:

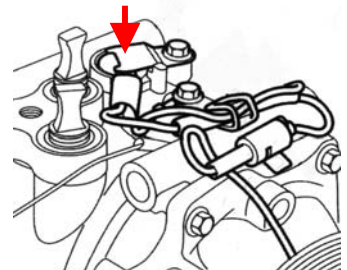

- Remove the compressor
- Remove the thermal switch locking device (fig.)
- Disconnect the electrical connections of the switch
- Pull the thermal switch up and out by turning it backwards and forwards using a suitable tool
- Remove residual silicone adhesive
- Apply a thin layer of silicone on the underside of the new thermal switch
- Insert the new thermal switch and mount the locking device
- Reconnect to the wiring system
- Install the compressor
- Carry out functional test

Note: Before installing the compressor check the oil level and / or replace the oil.

Bulletin