



## **Saab 9-5** **Up to chassis number W3051800**

### **Number plate light does not illuminate.**


If the number plate light on this vehicle does not illuminate, a possible cause could be the deformation of the lamp bracket. Due to the heat the lamp brackets are deformed and the lamps go out. To solve the problem the lamp brackets must be changed to a new version.

For that consider the following steps:


- Remove the 4 screws of the number plate light baffle.
- Remove the baffle by pushing it to the right and down.
- Remove the rubber cover and wirings from both lamps.
- Pull off the old lamp brackets and change them for the new version.
- Refit all parts in reverse order.

The new bracket version is available from Saab.

From the chassis number W3051801, the new bracket version is fitted by Saab.

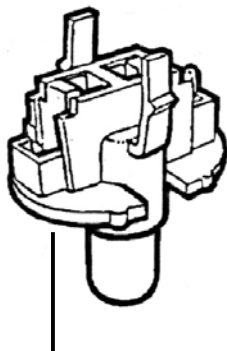

Old bracket

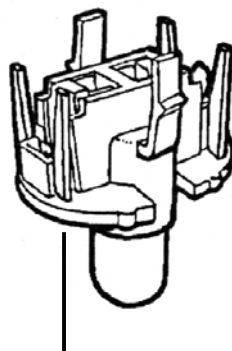

New bracket