




Toyota Land Cruiser Model year: 1998 - 2000

Condenser fan runs permanently

If in the case of the above-mentioned vehicles the condenser fan should continue running after the ignition has been switched off, one possible cause is a faulty condenser fan relay. In the case of vehicles up to chassis no.:

JT3HT05J#Y0114880 corrosion on the relay connector can lead to the condenser fan remaining on permanently. To remedy the problem, connection contacts should be cleaned and protected from further corrosion. If necessary the relay and/or connector have to be replaced. There is a repair set available from the vehicle manufacturer for this purpose. The relay is in the front part of the engine compartment (drawing, pos. 1).

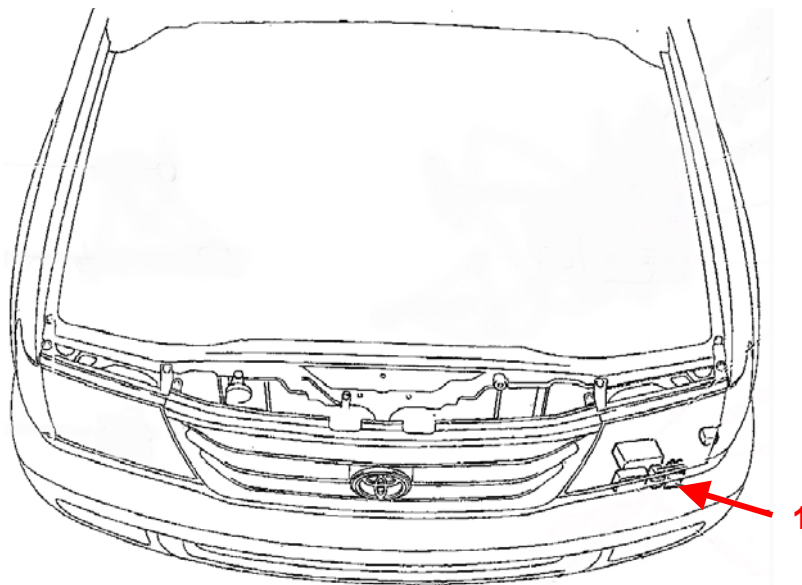

Bulletin