




VW Golf4/Bora up to 10.99

Sanden-compressor: Noise/without function

It can occur with this vehicle, that the securing nut becomes loose, this is due to a wrong torque being applied to the compressor-shaft nut. This can lead to noises or even to the failure of the compressor.

After inspection of compressor-shaft, magnetic-coil and fastening nut, for continued use the nut should be tightened to 25 Nm.

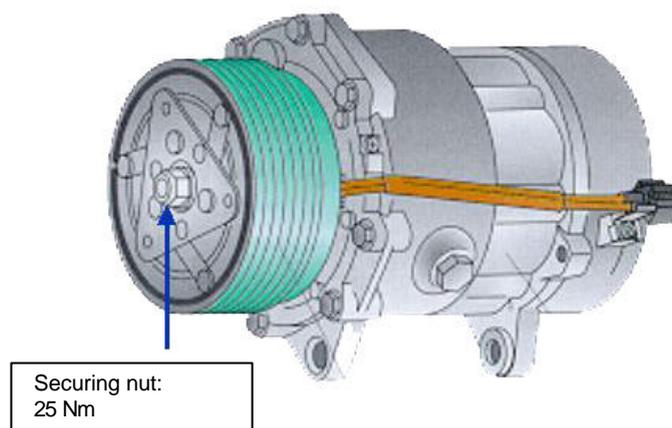

Bulletin