



## **VW**


### **New Beetle (9C1, 1C1)**

### **With air conditioning**

#### **Air conditioning / condenser fan not working**

If failures of the air conditioning or/and of the condenser fan arise in the above-mentioned vehicles, this may be the result of burnt fuse contacts on the fuse carrier of the battery. Due to the high current consumption, the plug contacts on the fuse carrier can char; usually the fuse itself does not blow. To resolve this problem, and to prevent failure of the air conditioning, the fuses and plug contacts should be checked, and replaced if there are signs of burns/charring (picture) of the fuse carriers.

There is the possibility that this fault occurs on other vehicle models as well.

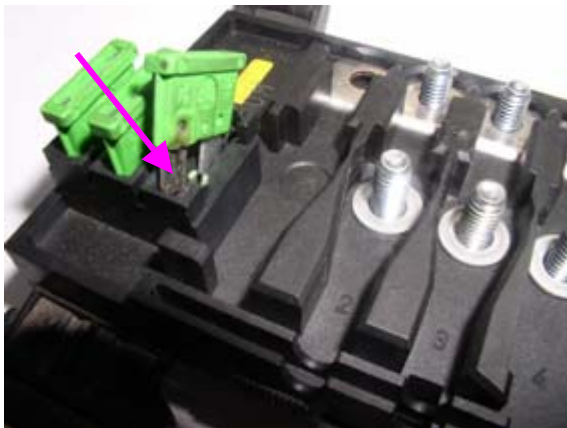

Bulletin