

826245 failure due to a faulty semi-automatic transmission control unit

Part Number: 826245


For Vehicle: Citroen C2 and C3 models with semi-automatic transmission

The Valeo Service Technical department have had several claims stating that after fitment of clutch kit 826245 gears cannot be selected, the engine will not start and no fault codes are displayed.

After investigating the issue Valeo technicians have identified that the clutch kit itself is not at fault and the defect is with the semi-automatic transmission control unit. To fix the issue please ensure the following steps are followed:

- 1) Back up the current configurations
- 2) Replace the semi-automatic transmission control unit
- 3) Reprogram the semi-automatic transmission control unit
- 4) Initialise the gearbox
- 5) Initialise the clutch

Specific tooling maybe required to complete some of the above steps. Please contact a Citroen dealer if necessary.

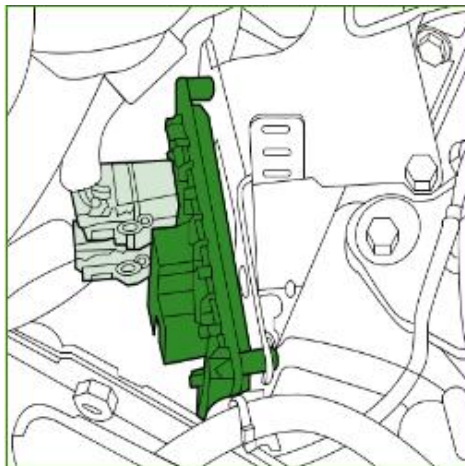

Replace the semi-automatic transmission control unit