

## Applying sealant on CSC's 804571, 810027 and 804506


Part Number: 804571 - 810027 - 804506

For Vehicle: Ford applications

Valeo have received a number of returned CSC's that have been described as leaking. After conducting analysis the units were found to be contaminated with gear oil.

After monitoring the returns it was noted that the units being returned had been fitted with insufficient, incorrect or no sealant between the CSC back plate and gearbox mating face.

It is required that sealant WSK-M2G348-A5 be used on the back plate of the CSC to create a gasket between the back plate and gearbox mating face.

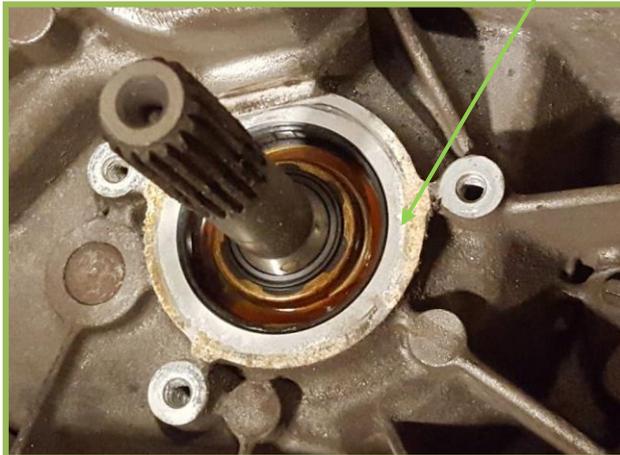

*Ensure gearbox mating face is clean and clear of debris*



*Apply the gasket compound to the CSC back plate*