

Gearbox control module fault

Part Number: 828312


For Vehicle: Renault Megane 2.0 2002>

The Valeo Service Technical department have received several claims stating that after fitment of clutch kit 828312, difficulty in gear selection and jamming of the gear lever was being experienced.

After further investigation Valeo technicians have identified that the clutch kit is not at fault. The root cause is related to the gearbox control module malfunctioning.

To fix the issue Valeo Service recommend to check the following:

- 1) Remove the air inlet duct
- 2) Remove the battery and tray
- 3) Disconnect the gear-shift cables from the gearbox
- 4) Replace the gear-shift control module
- 5) Reconnect the gear-shift cables to the gearbox
- 6), Adjust the gear-shift mechanism following the manufacturer's instructions

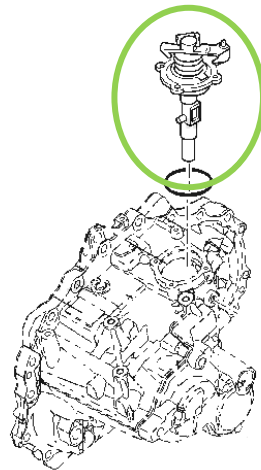

Please note there is no need to change the clutch kit