

Blue Print ADP152207

To fit:
various Citroën, DS, Fiat, Mitsubishi, Peugeot and Toyota models

Engine: 1.4 and 1.6 diesel

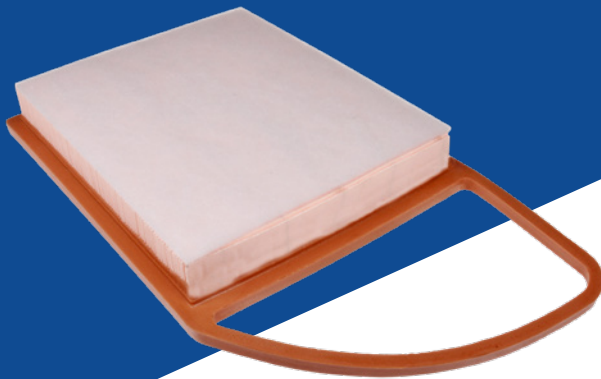


Figure.1

EN

Air filter

Problem

When replacing the air filter element in the vehicles listed above, care must be taken to make sure the foam seal of the filter element is installed correctly into the air filter housing. An incorrect installation can result in the foam seal being damaged or cut by the upper part of the filter housing during assembly. Damaged or cut parts of the seal can be ingested into the engine, resulting in engine damage. (Fig.1)

Cause

The foam seal loop of the air filter element, which seals the air intake section of the housing, can be distorted or misaligned during installation.

Solution

Before installing this filter, check the new part for any distortion or damage. Remove the top of the filter housing, then take out the old filter element and clean any loose debris from the housing. Place the new filter element into the filter housing, ensuring the foam seal of the filter is correctly installed before refitting the housing cover. (Fig.2)

Slide the filter housing cover into the locating pegs at the back of the housing and lower into position. Ensure the filter seal and housing securely fits together before tightening the fastenings. (Fig.3)



Figure.2



Figure.3

For more technical information please visit: partsfinder.bilsteingroup.com